

## Engineering Change Notice (ECN)

**Design Affected:** DA14680 wearable daughter board (224-37-C)

**Function affected:** NFC operation

**Symptom:** NFC is failing to connect even in contactless mode

**Recommended solution:**

De-coupling capacitor C134 (1uF) connected at the power supply pin of the NFC module LA66C300 has to be de-assembled for the NFC contactless mode to operate as expected:

