

Errata

SLG47105

CE-GP-003

Abstract

This document contains the known errata for SLG47105 and the recommended workarounds.

SLG47105 Errata

1 Information

Package(s)	20-pin STQFN: 2 mm x 3 mm x 0.55 mm, 0.4 mm pitch
-------------------	---

2 Errata Summary

Table 1: Errata Summary

Issue #	Issue Title
1	Dependence of Current Consumption on I²C Read/Write Operation
2	Shifted Rising Edge of the Cycle when the Fast Decay is Applied

3 Errata Details

3.1 Dependence of Current Consumption on I²C Read/Write Operation

3.1.1 Effect

Chip Current

3.1.2 Conditions

When I²C Read/Write operation stops at certain addresses.

3.1.3 Technical Description

Read/Write operation at certain addresses via I²C can cause significant current consumption increase. The amount of current drawn by the chip is highly dependent on V_{DD} voltage that is applied to the IC, please see [Table 2](#).

Table 2: Chip Current Consumption

V _{DD}	Current Consumption After I ² C Interaction with Problematic Addresses	Normal Current Consumption After I ² C Interaction
2.3 V	39-150 μ A	0.033 μ A
2.5 V	45-93 μ A	0.033 μ A
3.3 V	84-339 μ A	0.035 μ A
4.0 V	121-488 μ A	0.035 μ A
5.0 V	177-710 μ A	0.040 μ A
5.5 V	206-822 μ A	0.040 μ A

I²C Address pointer increases after the stop of I²C operation. So, in case when Read/Write command stops right before the problematic address, the current consumption increase will appear.

Value of an excess current changes relative to the value of a register being read/written. Most likely, current consumption will increase in the case of reading «1» from the problematic register or writing «0» to it.

SLG47105 Errata
3.1.4 Workaround

The best workaround is not to stop the I²C Read/Write operation on the problematic addresses (for example, instead of reading just 0x4E and 0x4F addresses, the Sequential Read Command should include addresses 0x4E, 0x4F, 0x50). This helps to keep an increase time as short as possible.

Also, the problem could be solved by initiating another Read/Write operation with an unaffected address. For the known problematic addresses refer to [Table 3](#).

Table 3: Known Problematic Addresses

Address	0x48	0x49	0x4A	0x4B	0x4D	0x4E	0x4F	0x89
Operation	R/W	R/W	R/W	R/W	R/W	R/W	W	W
Address	0x8A	0x8B	0xA4	0xA5	0xF9	0xFB	0xFC	
Operation	R	W	R/W	R/W	W	R/W	W	

3.2 Shifted Rising Edge of the Cycle when the Fast Decay is Applied
3.2.1 Effect

High Side Pin

3.2.2 Conditions

When Fast Decay mode is applied.

3.2.3 Technical Description:

In the Fast Decay mode, the negative voltage, created by the inductive load on the HV_GPO_HD pin, discharges the internal Charge Pump due to the parasitic p-n junction. Because of this, the Rising Edge on the High Side pin shifts. The duration of the shift depends on the Duty Cycle, the High Side input voltage (V_{DD2}), and the PWM frequency.

For example, the PWM Duty Cycle values higher than 75 % in a combination with V_{DD2} voltage lower than 3.75 V, and the Fast Decay settings applied can cause this problem, please see [Figure 1](#) and [Figure 2](#).

Note: HV GPO_0/1 are set to H-Bridge, Slow Slew Rate, Mode Control: PH-EN. In this case, EN is «HIGH», DECAY MODE Input is «LOW» (Fast Decay).

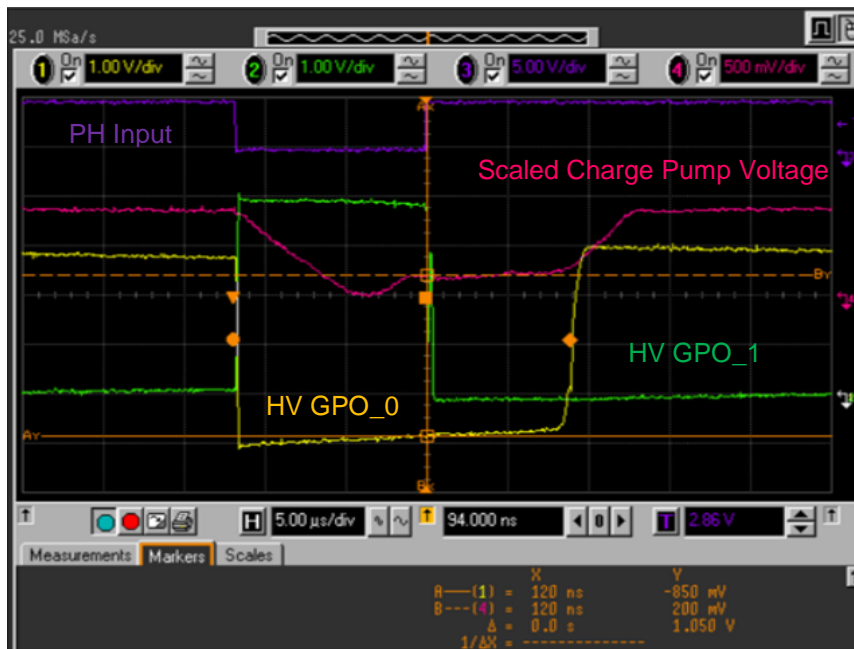


Figure 1: Shifted Rising Edge ($V_{DD2} = 3.0\text{ V}$, Fast Decay, PWM = 75+ %)

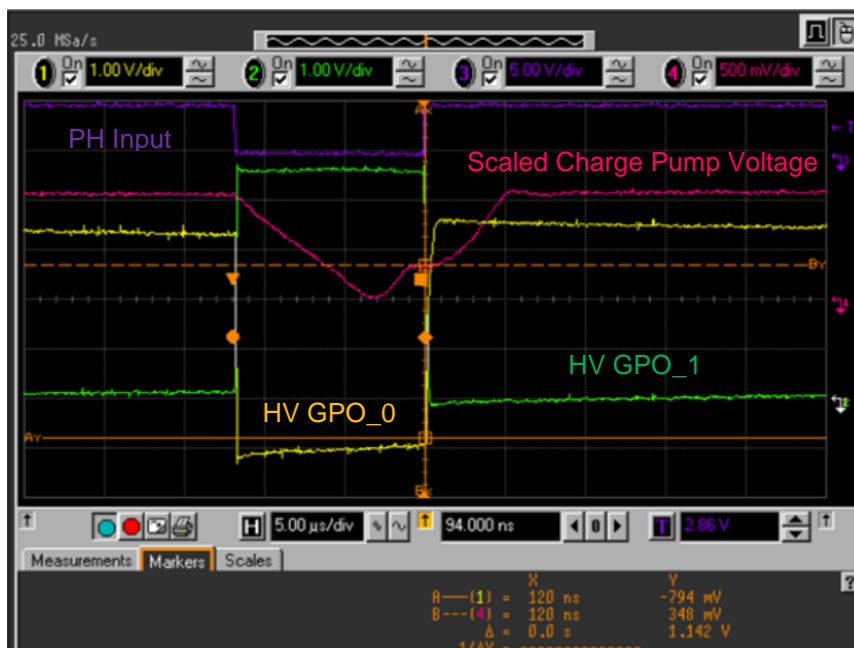


Figure 2: Discharge of the Internal Charge Pump ($V_{DD2} = 3.75\text{ V}$, Fast Decay, PWM = 75+ %)

3.2.4 Workaround:

The best way to exclude a possibility of such a malfunction is to use the Slow Decay option for the H-Bridge instead of the Fast Decay. No evidence of improper behavior has been discovered when V_{DD2} is higher than 3.75 V and the Fast Decay settings are applied. The chip is not affected by this problem when the load is resistive, because the negative voltage will appear on a pin only when the inductive load discharges.

SLG47105 Errata

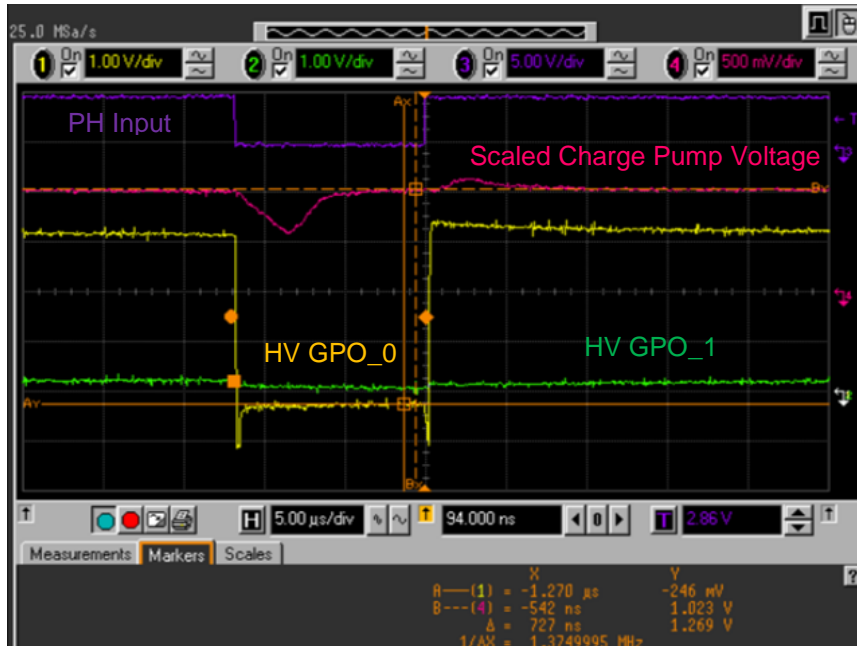


Figure 3: Rising Edge is Not Shifted ($V_{DD2} = 3.75$ V, Slow Decay, PWM = 75+ %)

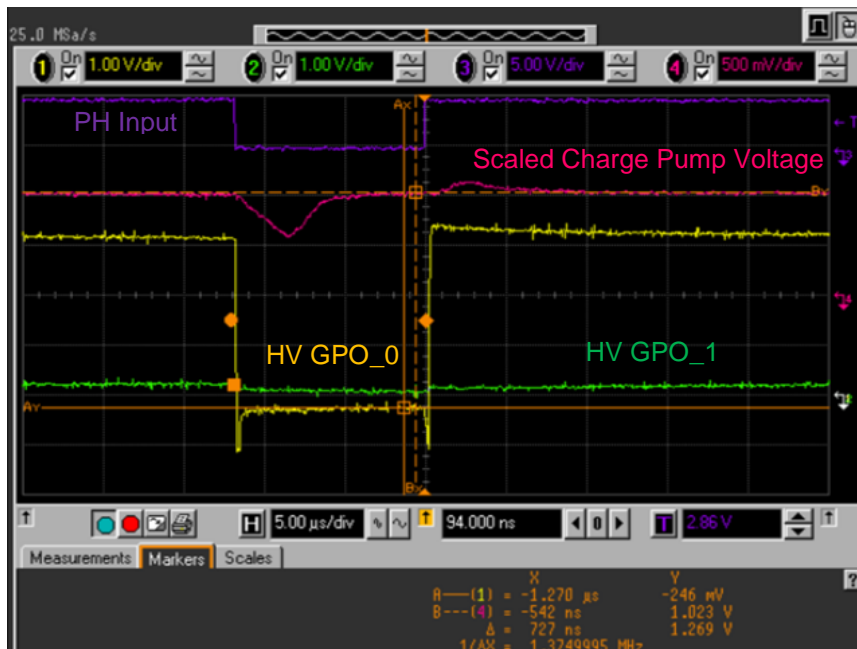


Figure 4: Low V_{DD2} Voltage Operation ($V_{DD2} = 2.75$ V, Slow Decay, PWM = 75+ %)

Document Revision History

Revision	Date	Description
1.1	24-Jun-2020	Updated according to new Dialog's format

SLG47105 Errata

Status Definitions

Status	Definition
DRAFT	The content of this document is under review and subject to formal approval, which may result in modifications or additions.
APPROVED or unmarked	The content of this document has been approved for publication.

Disclaimer

Unless otherwise agreed in writing, the Dialog Semiconductor products (and any associated software) referred to in this document are not designed, authorized or warranted to be suitable for use in life support, life-critical or safety-critical systems or equipment, nor in applications where failure or malfunction of a Dialog Semiconductor product (or associated software) can reasonably be expected to result in personal injury, death or severe property or environmental damage. Dialog Semiconductor and its suppliers accept no liability for inclusion and/or use of Dialog Semiconductor products (and any associated software) in such equipment or applications and therefore such inclusion and/or use is at the customer's own risk.

Information in this document is believed to be accurate and reliable. However, Dialog Semiconductor does not give any representations or warranties, express or implied, as to the accuracy or completeness of such information. Dialog Semiconductor furthermore takes no responsibility whatsoever for the content in this document if provided by any information source outside of Dialog Semiconductor.

Dialog Semiconductor reserves the right to change without notice the information published in this document, including, without limitation, the specification and the design of the related semiconductor products, software and applications. Notwithstanding the foregoing, for any automotive grade version of the device, Dialog Semiconductor reserves the right to change the information published in this document, including, without limitation, the specification and the design of the related semiconductor products, software and applications, in accordance with its standard automotive change notification process.

Applications, software, and semiconductor products described in this document are for illustrative purposes only. Dialog Semiconductor makes no representation or warranty that such applications, software and semiconductor products will be suitable for the specified use without further testing or modification. Unless otherwise agreed in writing, such testing or modification is the sole responsibility of the customer and Dialog Semiconductor excludes all liability in this respect.

Nothing in this document may be construed as a license for customer to use the Dialog Semiconductor products, software and applications referred to in this document. Such license must be separately sought by customer with Dialog Semiconductor.

All use of Dialog Semiconductor products, software and applications referred to in this document is subject to Dialog Semiconductor's [Standard Terms and Conditions of Sale](http://www.dialog-semiconductor.com), available on the company website (www.dialog-semiconductor.com) unless otherwise stated.

Dialog, Dialog Semiconductor and the Dialog logo are trademarks of Dialog Semiconductor Plc or its subsidiaries. All other product or service names and marks are the property of their respective owners.

© 2020 Dialog Semiconductor. All rights reserved.

Contacting Dialog Semiconductor

United Kingdom (Headquarters)

Dialog Semiconductor (UK) LTD
Phone: +44 1793 757700

Germany

Dialog Semiconductor GmbH
Phone: +49 7021 805-0

The Netherlands

Dialog Semiconductor B.V.
Phone: +31 73 640 8822

Email:

enquiry@diasemi.com

North America

Dialog Semiconductor Inc.
Phone: +1 408 845 8500

Japan

Dialog Semiconductor K. K.
Phone: +81 3 5769 5100

Taiwan

Dialog Semiconductor Taiwan
Phone: +886 281 786 222

Web site:

www.dialog-semiconductor.com

Hong Kong

Dialog Semiconductor Hong Kong
Phone: +852 2607 4271

Korea

Dialog Semiconductor Korea
Phone: +82 2 3469 8200

China (Shenzhen)

Dialog Semiconductor China
Phone: +86 755 2981 3669

China (Shanghai)

Dialog Semiconductor China
Phone: +86 21 5424 9058